

Undercoat

10.Undercoat

A: SPECIFICATION

Repair material: PVC (NT guardcoat 5900FL)

CAUTION:


Perform warning so that under the coat will not become attached to locations other than shown and to the following locations.

- High-temperature parts related to the exhaust pipe
- Hoses, tubes and harness parts
- Installation surfaces of rear suspension, transmission, sub frame, etc.

(1) Application area and application thickness

| | |
|---|--------------------------------|
|  | 300 μm or more |
|  | 600 μm or more |
|  | 200 μm or more |
|  | The panel gap shall be filled. |

- Side view

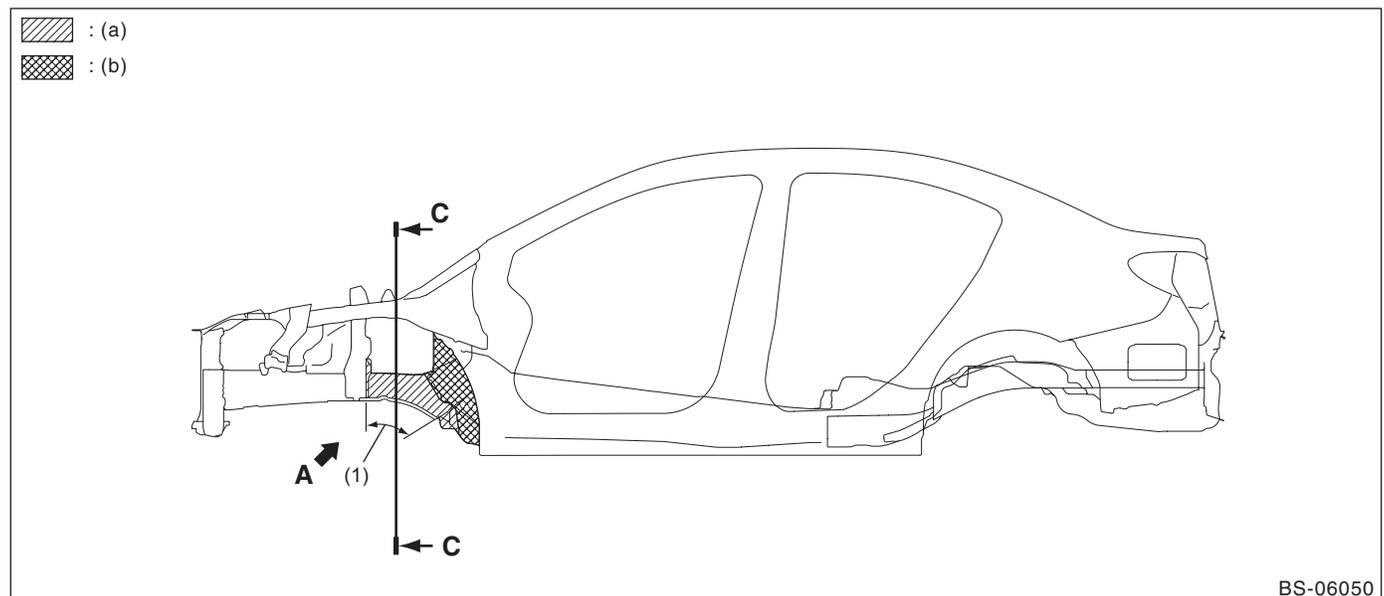


(a) 300 μm or more

(b) 600 μm or more

(1) 10 mm (0.39 in) (Adherence of mist is allowable.)


Undercoat

- Rear wheel apron side view

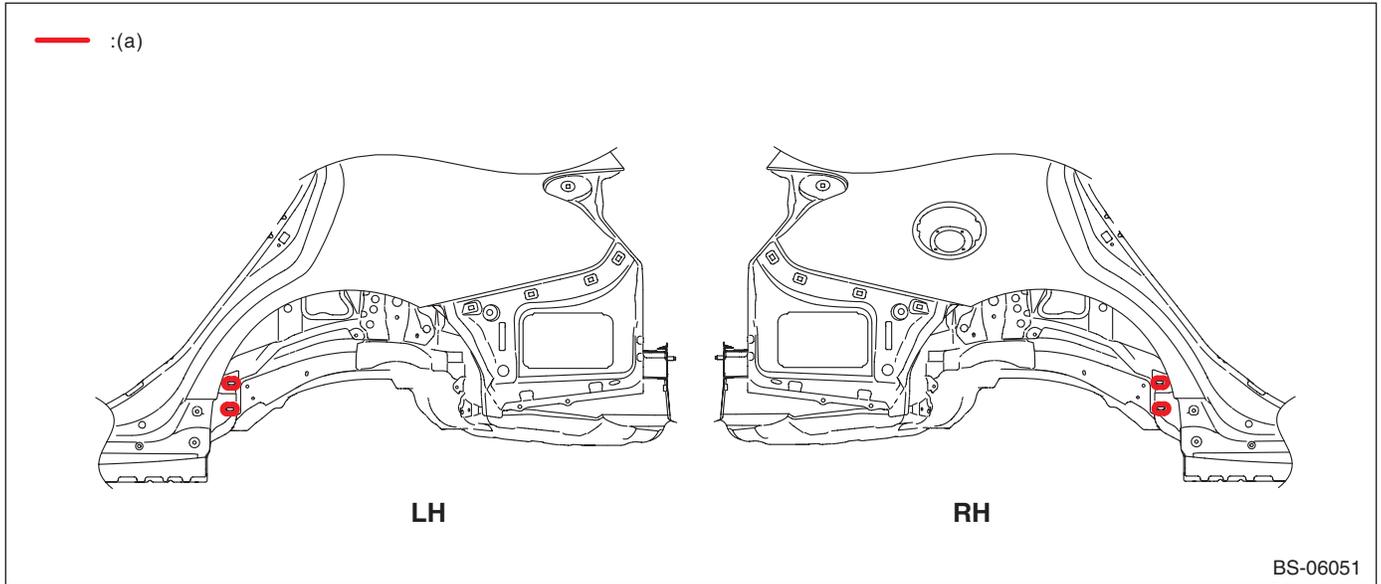

(a) The panel gap shall be filled.

- Bottom view

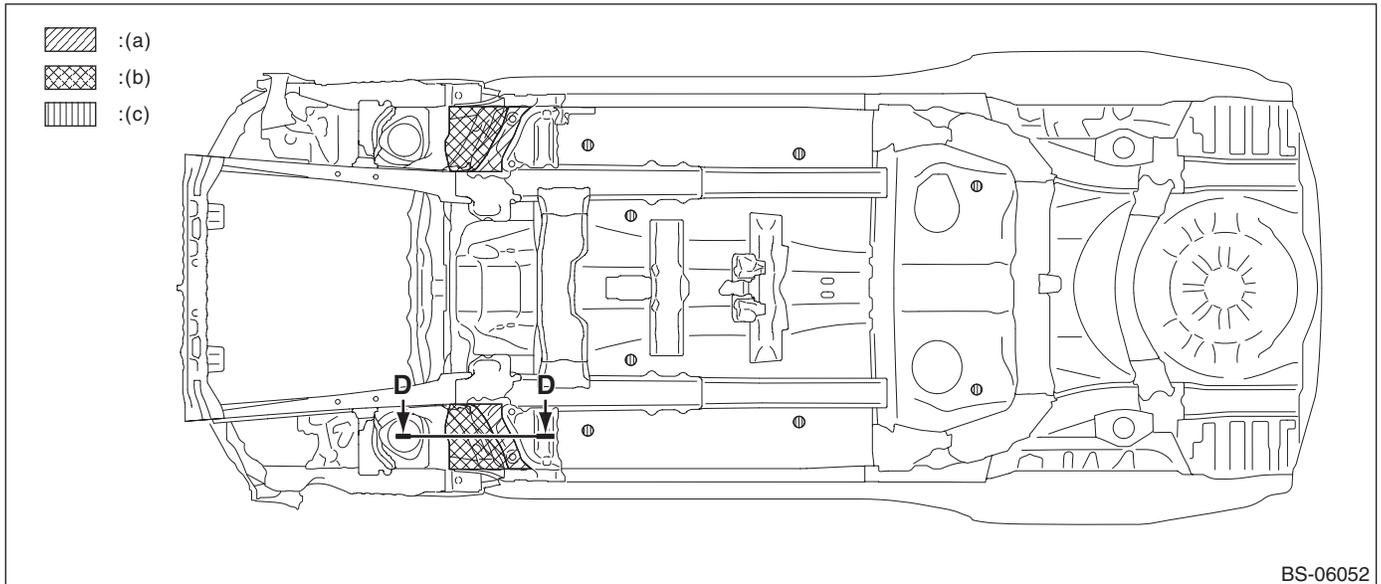


(a) 300 μm or more

(b) 600 μm or more

(c) 200 μm or more

Undercoat


View A

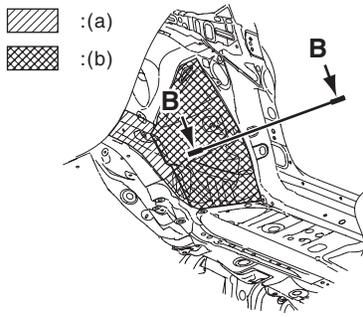

BS-06054

- (a) 300 μm or more
- (b) 600 μm or more


Cross section B — B

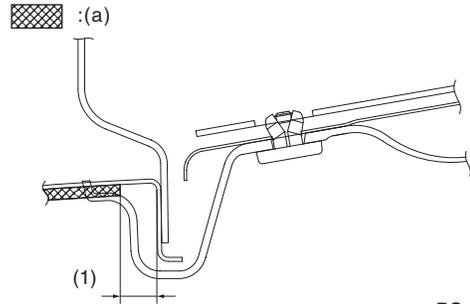

BS-06055

- (a) 600 μm or more
- (1) 10 mm (0.39 in) (Adherence of mist is allowable.)


Cross section C — C

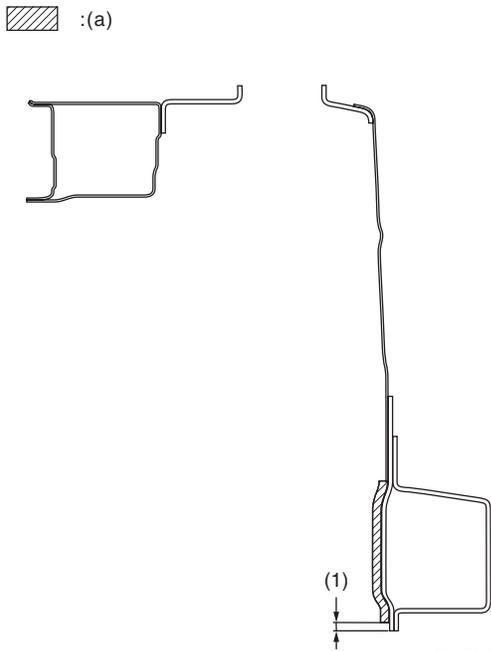

BS-06189

- (a) 300 μm or more
- (1) 10 mm (0.39 in) (Adherence of mist is allowable.)

Cross section D — D

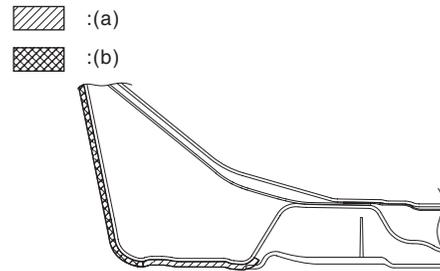

BS-06056

- (a) 300 μm or more
- (b) 600 μm or more

SUBARU.